

DIST	COUNTY	ROUTE	POST MILES TOTAL PROJECT	SHEET NO.	TOTAL SHEETS
William K. Farnbach REGISTERED CIVIL ENGINEER July 19, 2013 PLANS APPROVAL DATE THE STATE OF CALIFORNIA OR ITS OFFICERS OR AGENTS SHALL NOT BE RESPONSIBLE FOR THE ACCURACY OR COMPLETENESS OF SCANNED COPIES OF THIS PLAN SHEET.					

**LEGEND**




TO ACCOMPANY PLANS DATED \_\_\_\_\_


**NOTES:**

1. See Project Plans for spall repair locations.
2. Combine spall repair areas closer than 2' apart.
3. If the spall repair area is less than 6" from a joint, extend the repair to the joint.
4. Cut at least 2" beyond the rectangular limits of unsound concrete determined by the Engineer. Determine the saw cut depth using the following table:

Conc MATERIAL	SAW CUT DEPTH	
	Min	Max
FAST-SETTING	2"	3 1/2"
POLYESTER	1 1/2"	3 1/2"

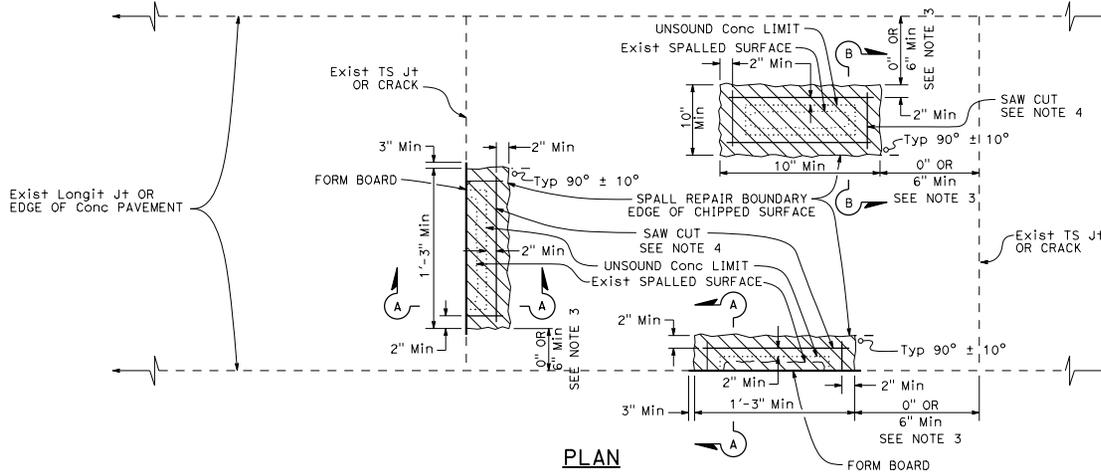


**PLAN**

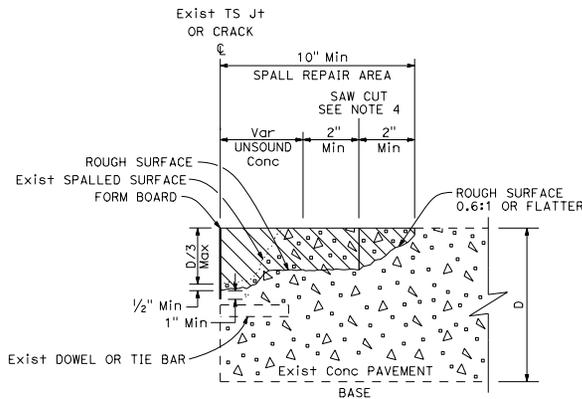

**SECTION A-A**

**JOINT, CRACK, OR EDGE OF CONCRETE PAVEMENT REPAIR**

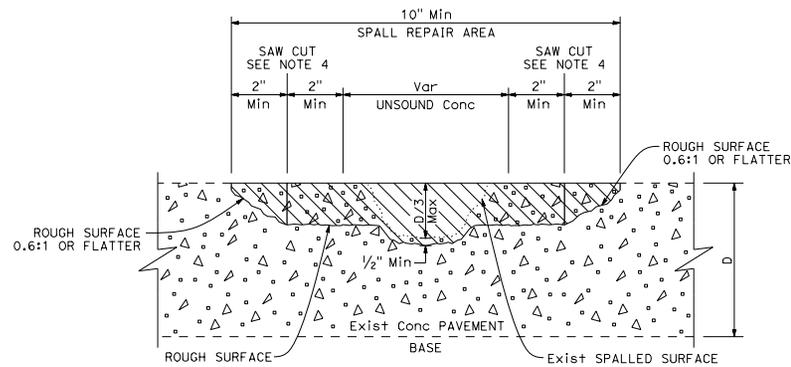

**SECTION B-B**

**MISCELLANEOUS SPALL REPAIR**

STATE OF CALIFORNIA  
DEPARTMENT OF TRANSPORTATION  
**SPALL REPAIR**  
NO SCALE

RSP P6 DATED JULY 19, 2013 SUPPLEMENTS THE STANDARD PLANS BOOK DATED 2010.

**REVISED STANDARD PLAN RSP P6**